





 



















Start with indicator powered on and in normal weighing mode

1		Press (Power & "SELECT" key) together for 2 seconds to access full setup mode	
2	 2x	Press ZERO key (2X)	
3	 1x	Press TARE key (1X)	
4	 1x	Remove all weight from scale Press SELECT Key (1X)	
5	 1x	Press PRINT key (1X) Z. in P Captured Zero Value:	 
6	 1x	Press TARE key twice (2X)	
7		Press F key twice (2X) <i>Clear Linearity; Y=Yes/N=No</i>	
8	Add Weight	Add weights to scale (<i>live load showing</i>)	
9	 1x	Press PRINT key (1X)	
10	 1x	Enter Weight Value: Use the Print key to change digit Use the Select Key to move digit	
11		Press the F key to Calibrate (1X) S. in P Captured Span Value Showing:	 
12		Press (Power & "SELECT" key) together for 2 seconds to save and exit.	