


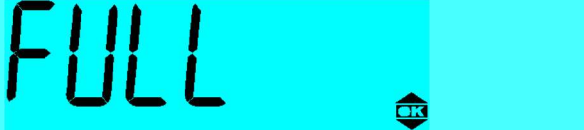















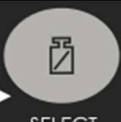


Quick Calibration Sheet – C3 Series ROW Version

 SELECT	LONG PRESS SELECT KEY, OPER WILL BE DISPLAYED.	
 SELECT	SHORT PRESS SELECT TWICE TO DISPLAY FULL.	
 OK	PRESS F2 [OK] KEY TO ACCEPT FULL SETUP.	
 ZERO	PRESS ZERO KEY 2 TIMES TO GET TO SCALE.	
 TARE	PRESS TARE KEY THREE TIMES TO GET TO CAL. SCALE MUST BE EMPTY.	
 SELECT	PRESS THE SELECT KEY ONCE THEN PRESS F2 TWICE. (‘Z IN P’; ZERO CAL CAPTURE)	
 	PRESS F3 KEY ONCE THEN PRESS SELECT TO SHOW SPAN. PRESS F2 KEY ONCE TO ENTER SPAN.	
 OK	SPAN CAL: (APPLY WEIGHTS) PRESS F2 KEY TO ACCEPT SPAN WEIGHTS.	
ENTER WEIGHT VALUE		 USE ARROW KEYS AND OK TO ENTER
 OK	PRESS F2 KEY TO CAPTURE SPAN. (‘S IN P’; SPAN CAL CAPTURE)	
 	PRESS F3 ONCE TO BACK OUT OF SPAN CAL THEN <u>PRESS AND HOLD</u> <u>POWER & F3</u> TO SAVE AND EXIT.	