


QUICK START CARD

LOAD CELL CONNECTION

Pin 1	+ Excitation
Pin 2	- Excitation
Pin 3	+ Signal
Pin 4	- Signal
Pin 5	+ Sense
Pin 6	- Sense
Pin 7	Shield

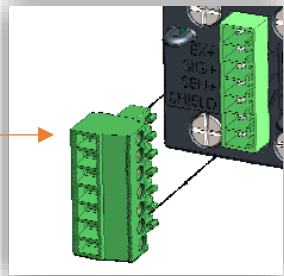

Note: (If using 4 wire) Jumpers are necessary. (+ Exc & + Sen)(-Exc & - Sen)

** Please Visit www.rinstrum.com Support pages for full manual and viewer software.



rinstrum C500 QUICK START CARD

	Long press	OPER
	PRESS 2 TIMES TO DISPLAY FULL SETUP	FULL
	PRESS F2 [OK] KEY TO ACCEPT FULL SETUP	BUILD
	PRESS ZERO KEY 2 TIMES TO GET TO CAL	CAL
	PRESS TARE KEY TO GET TO ZERO CAL	ZERO
	PRESS SELECT KEY ENTER THEN PRESS F2	 PRESS
	PRESS TARE KEY 2 TIMES TO SPAN	SPAN
	PRESS SELECT KEY TO ENTER SPAN THEN F2	 PRESS
ENTER WEIGH VAL.	03000	USE <, >, ^, v [ARROW KEYS] PRESS F2 [OK]
	PRESS ZERO KEY UNTIL <END> THEN PRESS TARE --SAVING THEN EXIT--	--END--